

VW, AUDI, SEAT, SKODA

Resetting Instrument Cluster Service Lights using Adaptation

CS2000, VAG, and VDS Pro

On some instrument clusters the one button reset of oil light may cause "Link Failure" message on the CS2000. If this occurs, use this standard reset procedure using the Adaptation Channels.

1. Choose Vehicle (VW, Audi, Seat, or Skoda). Press ENTER
2. Choose INTERIOR and press ENTER
3. Choose INSTRUMENT PANEL and press ENTER
4. At the Identification Screen press ENTER
5. Choose ADAPTATION and press ENTER
6. Now you are asked for a CHANNEL number. These Channel numbers correspond to different Service Interval functions
7. Enter the CHANNEL NUMBER on the keypad and press ENTER
8. Enter the ADAPTATION VALUE and press ENTER

CHANNEL	FUNCTION	ADAPTATION VALUE STANDARD	ADAPTATION RANGE	
005	Oil Service	00012	00000-00015	12,000 Km (7500 mi)
006	Inspection 1 Distance	00024	00000-00030	24,000 Km (15000)
007	Inspection 1 (Time)	00036	00000-00036	360 Days
008	Inspection 2 (Time)	00073	00000-00073	730 Days

Adaptation values can be changed to other values as follows:
Distance can be changed per 1000km, 6000km = 00006
Time can be changed per 10 days, 200 days = 00020

PDI : reset all channels

Oil Inspection : reset channel 005

Inspection 1 : reset channels 005, 006, 007

Inspection 2 : reset channels 005, 006, 007, 008