

VW, AUDI, SEAT, SKODA

Resetting Instrument Cluster Service Reminder

On some instrument clusters the one button reset of oil service may cause a "Link Failure" message on the CS2000. If this occurs use this standard reset procedure shown below for channel 02.

1. Choose Vehicle (VW, Audi, Seat or Skoda) and press ENTER.
2. Choose INTERIOR and press ENTER
3. Choose INSTRUMENT PANEL and press ENTER
4. At the Identification Screen press ENTER
5. For late model vehicles go to LOGIN and press ENTER
6. Enter your W SC number (0 1283) on the keypad. If this is not accepted, then Login is not necessary for this controller.
7. Press EXIT.
8. Choose ADAPTATION and press ENTER
9. Now you are asked for a CHANNEL number. These Channel numbers correspond to different Service Interval functions.
10. Enter the CHANNEL NUMBER on the keypad and press ENTER.
11. Enter the ADAPTION VALUE and press ENTER.

CHANNEL <small>Some controllers will require only 2 digits</small>	FUNCTION	ADAPTION VALUE Standard	ADAPTION* RANGE	Interpretation
002	Reset Oil and Inspection Reset Oil Service Reset Inspection 1 Reset Inspection 2	0000 00010 00001 00001 twice		This will reset the service intervals to the original time and distance programmed.
005	Oil Service (NewDistance)	00012	00000-00015	12,000km (7,500miles)
006	Inspection 1 (New Distance)	00024	00000-00030	24,000km (15,000miles)
007	Inspection 1 (New Time)	00036	00000-00036	360 days
008	Inspection 2 (New Time)	00073	00000-00073	730 days

*Adaption values can be changed to other values as follows:
 Distance can be changed per 1000km. 6,000km = 00006
 Time can be changed per 10 days. 200 days = 00020

PDI reset all channels.

Oil Inspection, reset channel 005.

Inspection 1, reset channels, 005, 006 and 007.

Inspection 2, reset channels, 005, 006, 007 and 008.